

# Manhole Inspection Summary

Manhole # S09C\_\_022MH

Printed On: 6/24/2010

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **09C** Node: **022** Status: **Found**

Insp Date: **1/26/09 11:39 AM**

Incomplete Comments

Crew: **SD WJ**  
Inspector: **Chung**  
Firm: **URS**

**Location** Address: **612 HILTON ST**

Cross Street: **EDMONDSON AVE**

**Manhole** Type: **Junction** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **2** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **2** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **4** Missing: **0** ☒ **Corroded**

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **3** (ft.) ☐ Active Surcharge Present

Location View



Top View




OFFSET



GRADE ADJUSTMENT




Defect 2

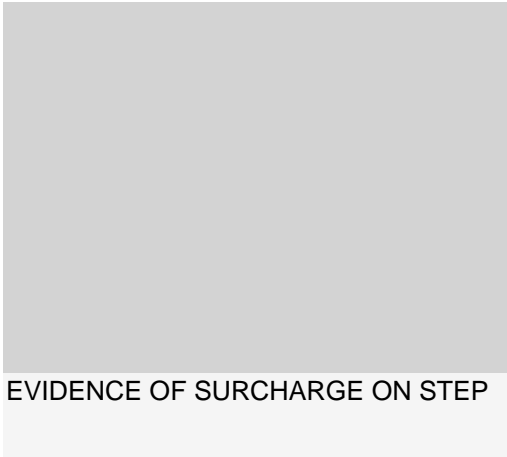

EVIDENCE OF SURCHARGE ON STEP

Defect 1

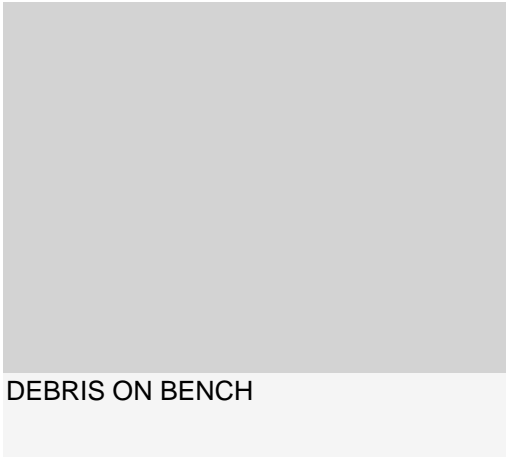

DEBRIS ON BENCH

## Manhole Inspection Summary

Manhole # S09C\_\_022MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.50** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow

Drop In @ 3 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.40** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar  
Angled: **Yes** Reading: **7.30** (ft.)  
Inv Depth: **8.30** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S09C\_\_022MH

Printed On: 6/24/2010

Page 4 of 4

8 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **8.20** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**  
☐ Possible Illicit Connection